

FRACTURE TOUGHNESS OF THE CANCELLOUS BONE OF *FNF* FEMORAL HEADS IN RELATION TO ITS MICROARCHITECTURE

C Greenwood (1) JG Clement (2) AJ Dicken (3) JPO Evans (3) I.D. Lyburn (4) RM Martin (5) KD Rogers (1) N Stone (6) G Adams (1) P Zioupos (1)

1. Cranfield Forensic Institute, Cranfield University, Defence Academy of the UK, UK; 2. Forensic Odontology, University of Melbourne, Australia; 3. The Imaging Science Group, Nottingham Trent University, UK; 4. Cobalt Health, Cheltenham, UK; 5. Social and Community Medicine, Bristol University, UK; 6. Physics and Astronomy, Exeter University, UK.

Introduction

This study considers the relationship between microarchitecture and mechanical properties for cancellous bone specimens collected from a cohort of patients who had suffered fractured necks of femur. OP is an acute skeletal condition with huge socioeconomic impact [1] and it is associated with changes in both bone quantity and quality [2], which affect greatly the strength and toughness of the tissue [3].

Methods

Over 88 samples from 37 femoral heads were dissected mechanically characterised for fracture toughness [3] and microCT scanned Nikon CT H225 (X-Tek Ltd) to derive the full gamut of microarchitectural parameters of the cancellous bone.

Results

The findings support a model where reduced bone mass results in a reduction in the number of trabeculae and trabeculae thickness and an increase in trabeculae spacing with concomitant changes in FT (Figure 1).

Conclusions

This study has crucially shown that TbTh, TbSp, SMI and TbN may provide a proxy or surrogate for BV/TV. Correlations were found between FT values and BV/TV, BS/TV, TbN, BS/BV and SMI. Overall, this study has highlighted that the fracture model based upon BMD could potentially be improved with inclusion of other microarchitecture parameters.

References

1. International Osteoporosis Foundation, <http://www.iofbonehealth.org/facts-statistics>
2. Hildebrand T, et al. J Bone Min Res, 14: 1167–74, 1999.
3. Cook RB & Zioupos P, J Biomechanics, 42: 2054–60, 2009.

Acknowledgements

Support was provided by the EPSRC (EP/K020196: Point-of-Care High Accuracy Fracture Risk Prediction), the UK Department of Transport under the BOSCOS (Bone Scanning for Occupant Safety) project, and approved by Gloucester and Cheltenham NHS Trust hospitals under ethical consent (BOSCOS – Mr. Curwen CI REC ref 01/179G).

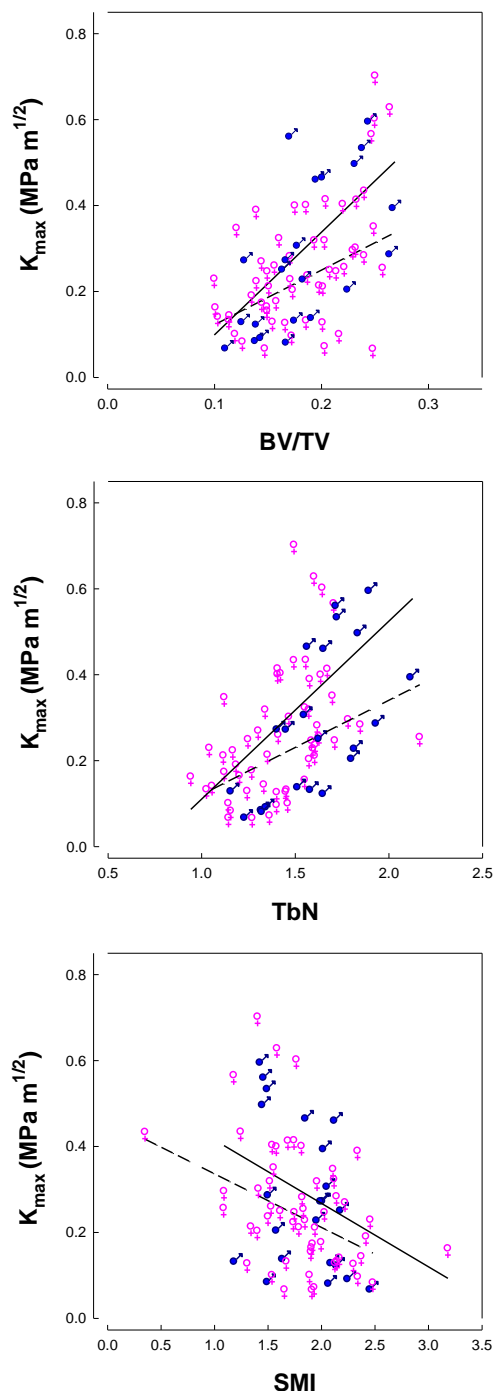


Figure 1: Critical stress intensity (K_C) as a function of various microarchitectural properties: (A) BV/TV; (B) TbN; (C) SMI. Male (♂) Female (♀).



Fracture toughness of the cancellous bone of FNF femoral heads in relation to its microarchitecture

Greenwood, Charlene

2016-07

C Greenwood, JG Clement, AJ Dicken, et al., (2016) Fracture toughness of the cancellous bone of FNF femoral heads in relation to its microarchitecture. 22nd Congress of the European Society of Biomechanics, July 10 - 13, 2016, Lyon, France

<http://dspace.lib.cranfield.ac.uk/handle/1826/10995>

Downloaded from CERES Research Repository, Cranfield University